RETURN TO TECHNICAL SERVICE BULLETIN TABLE OF CONTENTS
RETURN TO CD-ROM TABLE OF CONTENTS

DrägerService®

NARKOMED 6000
TECHNICAL SERVICE BULLETIN # 6002

Product: **Narkomed 6000**

Date: October 30, 2000

Re: **Vitalbus Hub J-13 connector orientation**

Reference Doc: **n / a**

Reason/Rational: To ensure proper installation of the small 2-pin wire harness at J-13 of the Vitalbus Hub PCB after repair or service work is performed. Incorrect orientation of this polarity sensitive cable will cause a system failure that may not be immediately recognized.

Solution/Procedure: When re-attaching the 2-pin wire harness to Vitalbus HUB at J-13, verify it's proper orientation. From the header connector the lead wires must route to the right and the brown wire must positioned above the black wire. See attached illustration Figure 1. Also refer to Narkomed 6000 Technical Service manual Replacement Procedures, Section - 4 for complete servicing instructions.

Devices affected: Any Narkomed 6000 requiring the disconnection of 2-pin wire harness at J-13 of Vitalbus HUB.

Timing/When: Next Vitalbus HUB service or replacement.

Additional Info: **n/a**

Cost: **n/a**

Ordering Info/Parts: **n/a**

Distribution: All Authorized Service Organizations, DrägerService

If you have any questions, please contact Technical Support by phone at 1-800-543-5047 or by fax at 1-215-721-5789.

DrägerService
3122 Commerce Drive
Telford, PA 18969
Tel: (215) 721-5402
(800) 543-5047
Fax: (215) 723-5935
Web: www.draegermedical.com

DrägerService®

NARKOMED 6000 **Page - 2**
TECHNICAL SERVICE BULLETIN # 6002

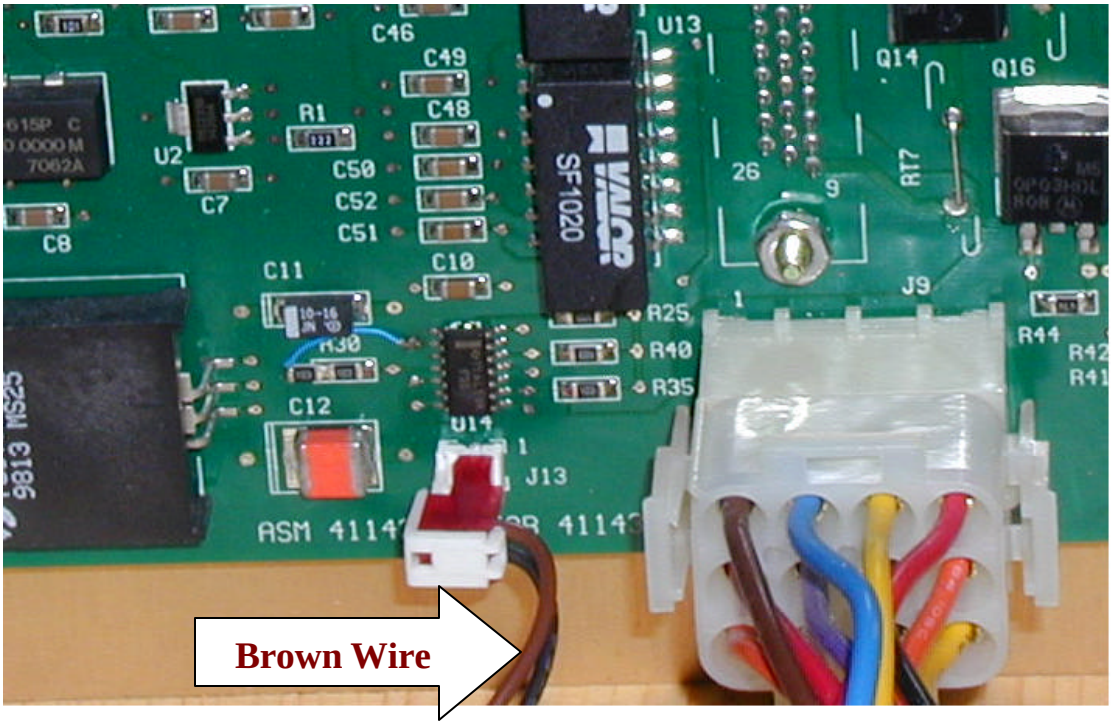

Figure-1 Vitalbus HUB J-13 Connector Orientation

DrägerService
3122 Commerce Drive
Telford, PA 18969
Tel: (215) 721-5402
(800) 543-5047
Fax: (215) 723-5935
Web: www.draegermedical.com